


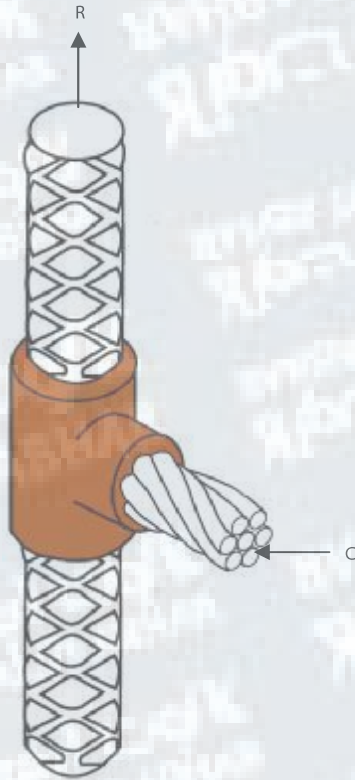


CR6-Cable to Rebar (continued)

Rebar mm ²	Cable mm ²	Welding Powder	Mould
16	95	KWD 200	CR6-16-095
16	120	KWD 200	CR6-16-120
16	150	KWD 250	CR6-16-150
20	16	KWD 150	CR6-20-016
20	25	KWD 150	CR6-20-025
20	35	KWD 150	CR6-20-035
20	50	KWD 200	CR6-20-050
20	70	KWD 200	CR6-20-070
20	95	KWD 200	CR6-20-095
20	120	KWD 250	CR6-20-120
20	150	KWD 250	CR6-20-150
20	185	2 x KWD 150	CR6-20-185
20	240	2 x KWD 200	CR6-20-240

Handle clamp : HC 01 is suitable for these moulds

CR17-Cable to Rebar

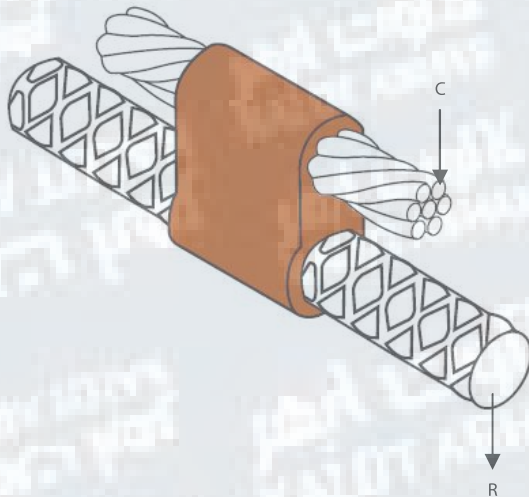

Rebar mm ²	Cable mm ²	Welding Powder	Mould
10 - 40	16	KWD 115	CR17-016
10 - 40	25	KWD 115	CR17-025
10 - 40	35	KWD 115	CR17-035
10 - 40	50	KWD 150	CR17-050
10 - 40	70	KWD 150	CR17-070
10 - 40	95	KWD 200	CR17-095
10 - 40	120	KWD 200	CR17-120
10 - 40	150	KWD 250	CR17-150
10 - 40	185	2 x KWD 150	CR17-185
10 - 40	240	2 x KWD 150	CR17-240
10 - 40	300	2 x KWD 150	CR17-300

Handle clamp : HC 01 is suitable for these moulds

Attention:

1- Our routine sizes and weld connections are listed in this catalogue; for other types and sizes please contact our sales office.